

Power Equipment

CODE NO: CC-188

DATE: JANUARY 19, 1990

SUBJECT: SLOW REVERSE SPEED ON 1990 HYDRO GARDEN TRACTORS

PROBLEM: CAM PIVOT BRACKET OUT OF ADJUSTMENT

SOLUTION: ADJUST CAM PIVOT BRACKET

IF YOUR REVERSE SPEED IS TOO SLOW THE CAM PIVOT BRACKET IS OUT OF ADJUSTMENT. TO CORRECT THE PROBLEM, LOOSEN THE TWO HEX CAP SCREWS SECURING THE CAM PIVOT BRACKET AND MOVE THE CAM PIVOT BRACKET DOWN UNTIL THE FLAT WASHER IS EVEN WITH THE TOP OF THE CAM PIVOT BRACKET.

TIGHTEN THE SCREWS AND TEST. IT MAY BE NECESSARY TO ADJUST THE CONNECTING ROD TO THE HYDROSTATIC CONTROL LEVER TO ALIGN THE DASHBOARD HYDROSTATIC CONTROL LEVER TO THE NEUTRAL POSITION.

