

Posted on Thursday, October 6, 2005 - 12:44 am:
ok folks, here is an addition to the hydrolift pump rebuild.
SEAL REPACEMENT.



pry out old seal with screwdriver



oil drain hole cannot be covered



found a socket the right size to drive in first seal



first seal installed showing drain hole still open



second seal goes in next, slightly below surface of casting, hole is chamfered



both seals in and drain hole still showing, but not in this picture! slight space between the seals to let individual seal lips move independantly



the pump ready for installation on the mounting bracket.
this concludes the hydrolift pump rebuild.
eric