

# Cub Cadet


## Power Equipment

Code No.: CC-148

Date: DECEMBER 2, 1987

Subject: INCORRECT DIPSTICKS ON GARDEN TRACTORS

If the transmission oil level is incorrect on a new garden tractor, verify that the tractor has the correct dipstick and tube before adding oil.

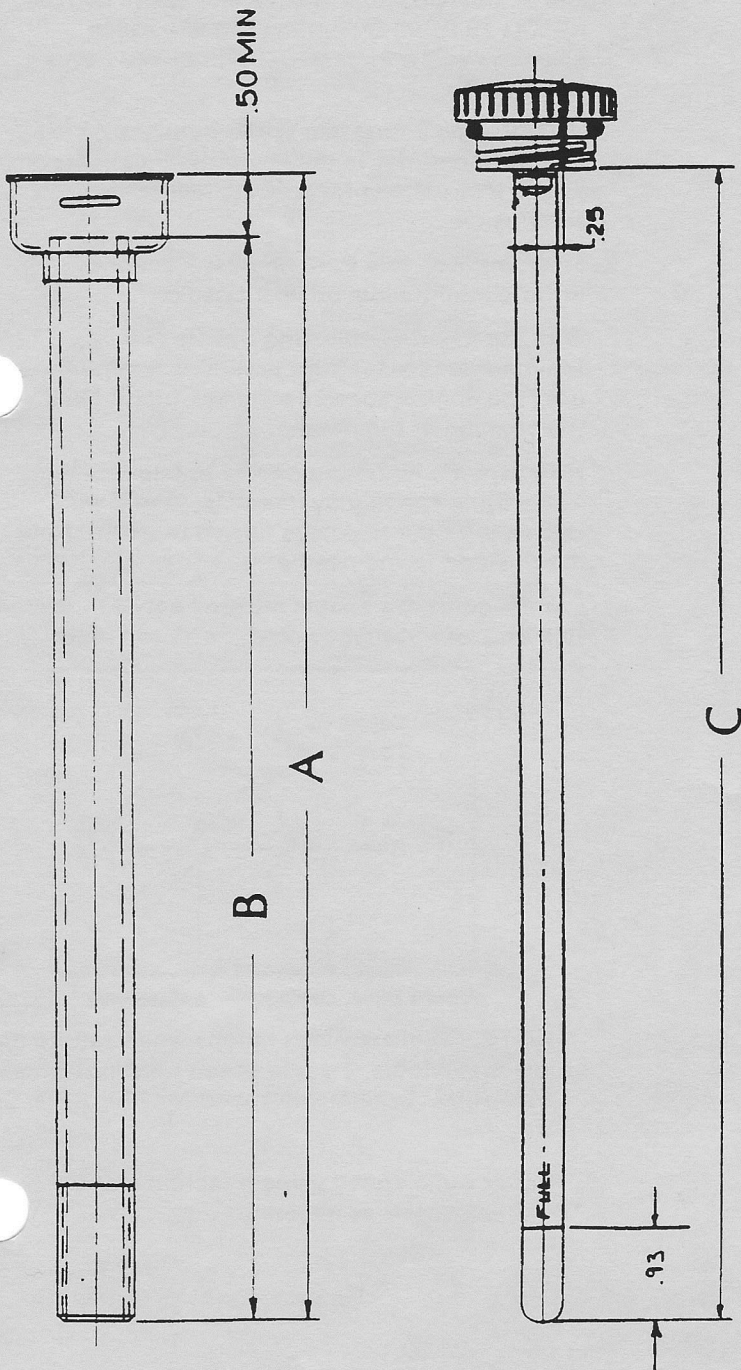

## Service Bulletin

HOOD LABEL	FACTORY NO.	OLD CCC NUMBER	TUBE NO.	TUBE DEM. A	TUBE DEM. B	DIPSTICK NO.	DIPSTICK DEM. C
1806	147-640-100	1606, 582	727-3028	9.25"	8.75"	703-0921	12.75"
1210	147-620-100	680	727-3028	9.25"	8.75"	703-0911	11.50"
1211	147-630-100		727-3028	9.25"	8.75"	703-0911	11.50"
1810	147-650-100	682, 782, 1710	727-3028	9.25"	8.75"	703-0911	11.50"
1811	147-660-100	782, 1711	727-3028	9.25"	8.75"	703-0911	11.50"
1812	147-670-100	784, 1712	727-3028	9.25"	8.75"	703-0911	11.50"
1512	147-882-100	882	727-3028	9.25"	8.75"	703-0911	11.50"
1572	147-710-100		727-3042	10.75"	10.25"	703-1496	12.00"
1872	147-720-100		727-3029	10.25"	9.75"	703-0911	11.50"
2072	147-730-100	982, 984, 986	727-3029	10.25"	9.75"	703-0911	11.50"